



## **Lino Bianco & Associates**

**Architectural, Structural Design Studio  
Environmental Management Consultancy  
Urban Planning and Design Consultancy**

---

# **Environmental Planning Statement**

---

Dairy Farm at Ta' Sqaq Awzara, Qormi, Malta

# Table of Contents

## 0.0 Non-Technical Summary

- 0.1 Description of the Proposed Development
  - 0.1.1 Access and Transport Arrangements
  - 0.1.2 Project Management Arrangements
  - 0.1.3 Waste Management
- 0.2 Description of the Proposed Site
  - 0.2.1 Water and Hydrological Features
  - 0.2.2 Cultural Heritage Features
  - 0.2.3 Ecology
  - 0.2.4 Agriculture and Soils
  - 0.2.5 Land Use
  - 0.2.6 Other Environmental Features
    - 0.2.6.1 Landscape Assessment
    - 0.2.6.2 Scenic Quality
- 0.3.0 Policy Framework
  - 0.3.1 Maltese Legislation
  - 0.3.2 Development Planning Policies
  - 0.3.3 Policies of Other Government Agencies
- 0.4 Assessment of Environmental Impacts and Risks of the Proposed Development
- 0.5 Design of Mitigation Measures

## 1.0 A Description of the Proposed Development

- 1.1.0 A Justification of the Proposal
  - 1.1.1 A Description of Objectives
  - 1.1.2 Current and Projected Need and Demand

- 1.2.0 A Description of the Physical Characteristics and Features of the Project including Construction and Operation
  - 1.2.1 Proposed Facilities
  - 1.2.2 Proposed Access and Transport Arrangements
- 1.3.0 A Description of the Land Use Requirements of the Project
- 1.4.0 A Description of the Operational Features of the Project
  - 1.4.1 Proposed Project Management Arrangements
  - 1.4.2 Types and Quantities of Raw Materials
  - 1.4.3 A Description of All Residues and Emissions
  - 1.4.4 Management of Solid and Liquid Wastes
    - 1.4.4.1 Solid Wastes
    - 1.4.4.2 Liquid Wastes
  - 1.4.4 Manure Management
  - 1.4.6 Rodent Control

## **2.0 Description of the Proposed Site**

- 2.1.0 A Description of the Site and its Surroundings
  - 2.1.1 Water and Hydrological Features
    - 2.1.1.1 Methodology
    - 2.1.1.2 Area Characteristics
    - 2.1.1.3 Hydrogeological Assessment of the Area
    - 2.1.1.4 Hydrogeological Evaluation of the Area
  - 2.1.2 Archaeological, Architectural and Historic Sites and Features and other Cultural Assets
    - 2.1.2.1 Methodology
    - 2.1.2.2 Cultural Heritage Assessment
    - 2.1.2.3 Cultural Asset Grading
  - 2.1.3 Ecology
    - 2.1.3.1 Methodology

- 2.1.3.2 Area Characteristics
- 2.1.3.3 Ecological Assessment
- 2.1.3.4 Ecological Evaluation

#### 2.1.4 Agriculture and Soils

- 2.1.4.1 Methodology
- 2.1.4.2 Area Characteristics
- 2.1.4.3 Agrarian Assessment of the Area
- 2.1.4.4 Agrarian Evaluation of the Area

#### 2.1.5 Land Use

- 2.1.5.1 Methodology
- 2.1.5.2 Area Characteristics
- 2.1.5.3 Land Use Assessment
- 2.1.5.4 Land Use Evaluation

#### 2.1.6 Any Other Relevant Environmental Features

- 2.1.6.1 Landscape Assessment
- 2.1.6.2 Scenic Quality

#### 2.2.0 References

## **3.0 Policy Framework**

#### 3.1.0 Maltese Legislation

- 3.1.1 Food, Drugs and Drinking Water Act, 1972
- 3.1.2 Fertile Soil (Preservation) Act , 1973
- 3.1.3 Development Planning Act, 1992
- 3.1.4 Preservation of Fertile Soil Regulations
- 3.1.5 Environment Protection (Sewer Discharge Control) Regulations
- 3.1.6 Rubble Walls and Rural Structures Regulations

#### 3.2.0 Development Planning Policies

- 3.2.1 Structure Plan

3.2.1.1 Built Environment Policies

3.2.1.2 Agriculture, Horticulture and Fisheries Policies

3.2.1.3 Rural Conservation Policies

3.2.1.4 Public Utilities Policies

3.2.2 Planning Authority - Policy and Design Guidance 3: Farmhouses and Agricultural Buildings

3.3.0 Policies of Other Government Agencies

3.3.1 Department of Agriculture

3.3.2 Water Protection Policies

3.4.0 References

## **4.0 Assessment of Environmental Impacts and Risks of the Proposed Development**

4.1.0 Impacts of the Proposed Project

## **5.0 Design of Mitigation Measures**

5.1.0 Mitigation Measures

5.2.0 Landscaping

5.2.1 Design Philosophy

5.2.2 Visual Impact of Proposed Landscaping Scheme

5.2.2.1 Viewpoint 1

5.2.2.2 Viewpoint 2

5.2.2.3 Viewpoint 3

5.2.3 Technical Considerations

5.2.3.1 Methods of soil handling

5.2.3.2 Tree Planting

5.2.3.3 Tree Types

# Appendices

Appendix No.	Title
A1	Terms of Reference
A2	Planning Application PA 2776/99
A3	Correspondence of the Water Services Corporation
A4	GHammeri Research and Development Centre : Housing system for cattle rearing

## Drawings

<b>Drawing No.</b>	<b>Title</b>	<b>Scale</b>
EIA9/1	Site Location Plan	1 : 2,500
EIA9/2	Hydrological Features	1 : 2,500
EIA9/3	Cultural Features	1 : 2,500
EIA9/4	Land Use	1 : 2,500
EIA9/5	Development Planning	1 : 2,000
EIA9/6	Recent Planning History	1 : 2,500
EIA9/7	Landscaping	As shown
EIA9/8	Views of Site	1 : 2,500

## Photos



Photo No.	Title
1	View of site (indicated by arrow)
2	Access to damaged well via Ta Awzara Alley
3	Watercourse at Wied is-Sewda in May 2001
4	Watercourse at Wied is-Sewda in December 2001
5	View of rubble walls within study area (refers to Drawing EIA9/3)
6	View of rubble walls within study area (refers to Drawing EIA9/3)
7	Boundary wall to proposed site for dairy farm (see arrow)
8	Boundary wall along road to Attard (wall type 1 in Drawing EIA9/3)
9	View of Type 2 walling (refer to Drawing EIA9/3)
10	View of Type 3 walling (refer to Drawing EIA9/3)
11	View of Type 4 walling (refer to Drawing EIA9/3)
12	View of Type 5 walling (refer to Drawing EIA9/3)
13	Rural Structure R <sub>1</sub> in Drawing EIA9/3
14	Rural Structure R <sub>2</sub> in Drawing EIA9/3
15	Rural Structure R <sub>3</sub> in Drawing EIA9/3
16	Country house along Wied is-Sewda
17	View of site in May 2001
18	View of site in December 2001
19	Southern part of site dominated by Field Bindweed ( <i>Convolvulus arvensis</i> )
20	Central part of site dominated by Brassicaceae
21	Dumping along bed of watercourse (May 2001)
22	Western extremity of degraded watercourse community at Wied is-Sewda
23	Remnants of water community including Pennyroyal ( <i>Mentha pulegium</i> )
24	Watercourse community dominated by Clustered Dock ( <i>Rumex conglomeratus</i> ) at Wied is-Sewda



25	Drip irrigation within study area
26	Cultivated fields in late autumn
27	Abandoned agricultural land
28	Illegal dumping
29	View of landscape east of proposed site for dairy farm
30	View of landscape north of proposed site for dairy farm
31	View of landscape west of proposed site for dairy farm
32	View of landscape south of proposed site for dairy farm

Some pages of this document have been omitted. To view the full article  
contact Lino Bianco & Associates at: [info@lino-bianco.com](mailto:info@lino-bianco.com)



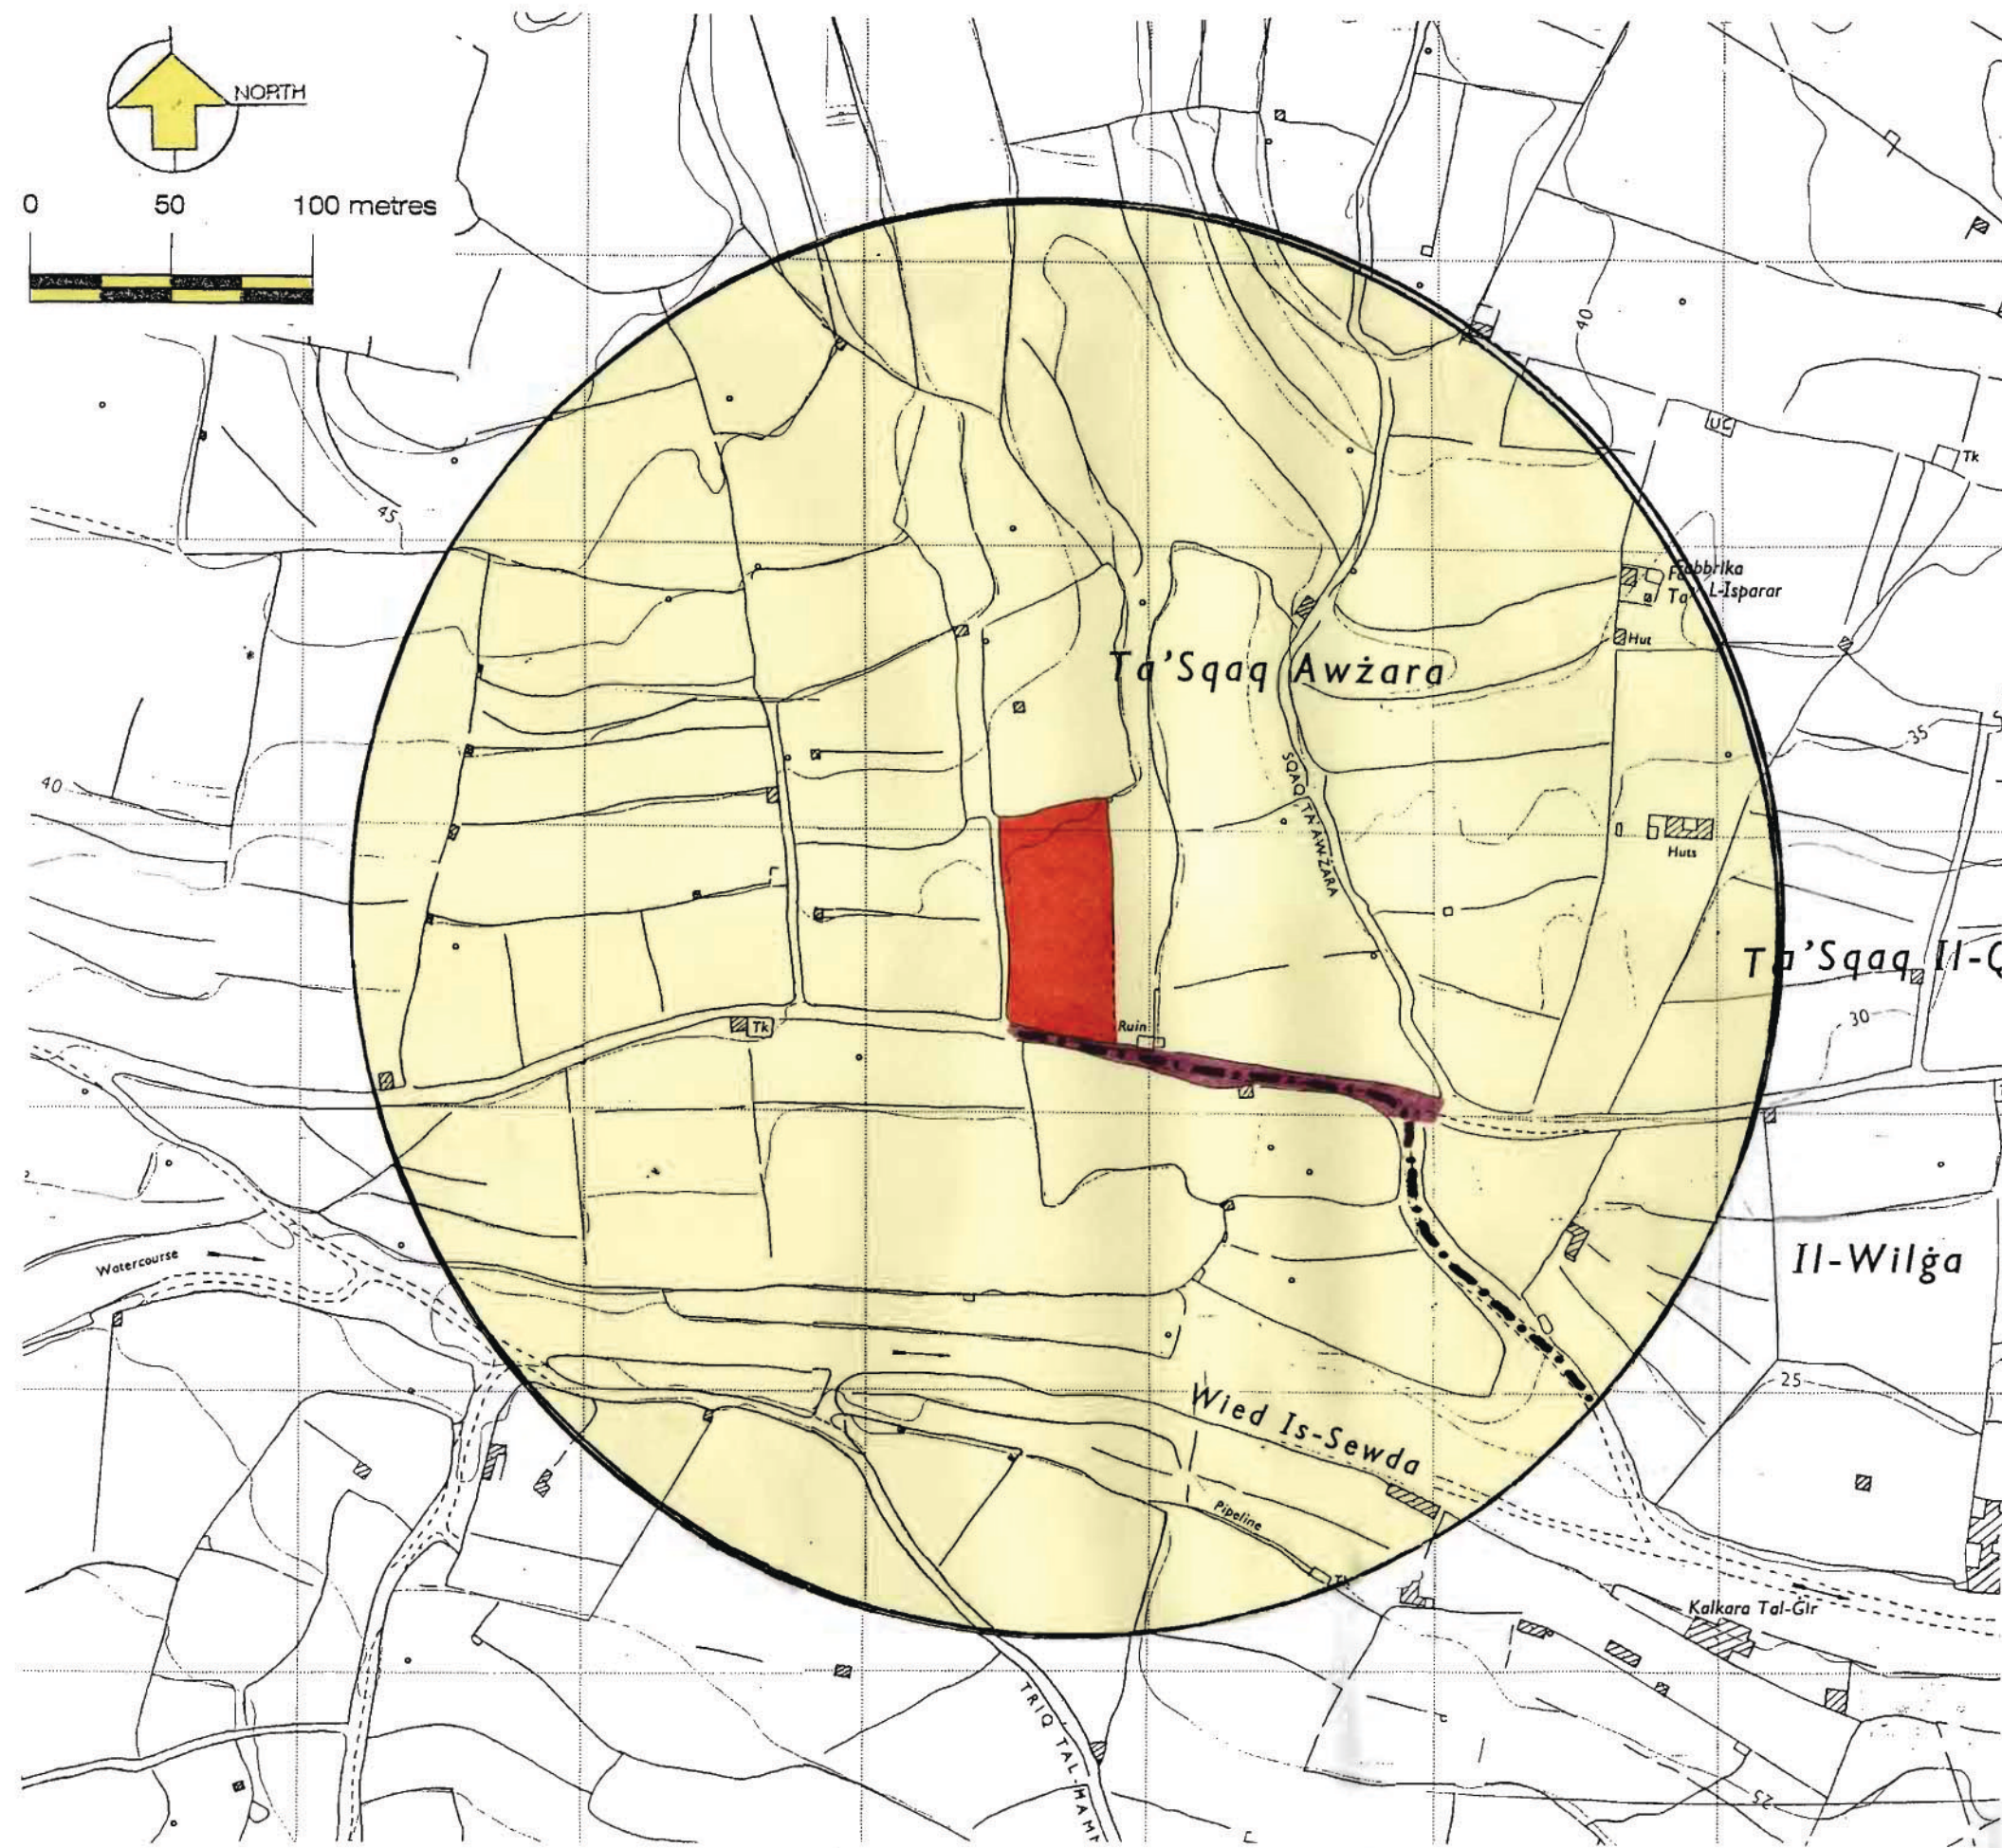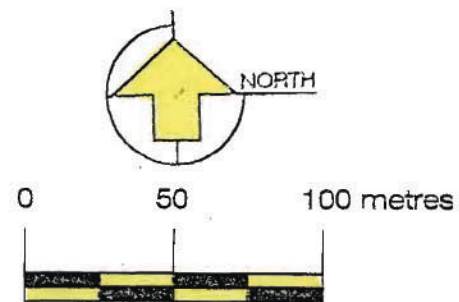

- Study area boundary
- Site boundary
- Access route
- Road predates the 20<sup>th</sup> century



99, Censu Bugeja Street, Hamrun HMR 10,  
MALTA (Europe)  
Tel: (356) 21241747, Mob: 9942 2727  
Fax: (356) 21251302  
E-mail: linobianco@global.net.mt

**IANCO & Associates**  
ARCHITECTURAL & STRUCTURAL DESIGN STUDIO  
ENVIRONMENTAL MANAGEMENT CONSULTANCY  
URBAN PLANNING & DESIGN CONSULTANCY

PROJECT TITLE :  
**OUTLINE PLANNING APPLICATION:  
DIARY FARM and FARMHOUSE  
QORMI, MALTA**

DRAWING TITLE :  
**SITE LOCATION PLAN**

SCALE:  
1 : 2,500

DATE:  
Dec '01

DRAWING NO.:  
EIA9/1



Some pages of this document have been omitted. To view the full article  
contact Lino Bianco & Associates at: [info@lino-bianco.com](mailto:info@lino-bianco.com)